


6.1 The Cyborg X200 quick lock vise.

6.1.1. Installing the X200 quick lock vise

The section below shows which steps you have to follow to fix the X200 quick lock vise on the X200 engraving table.

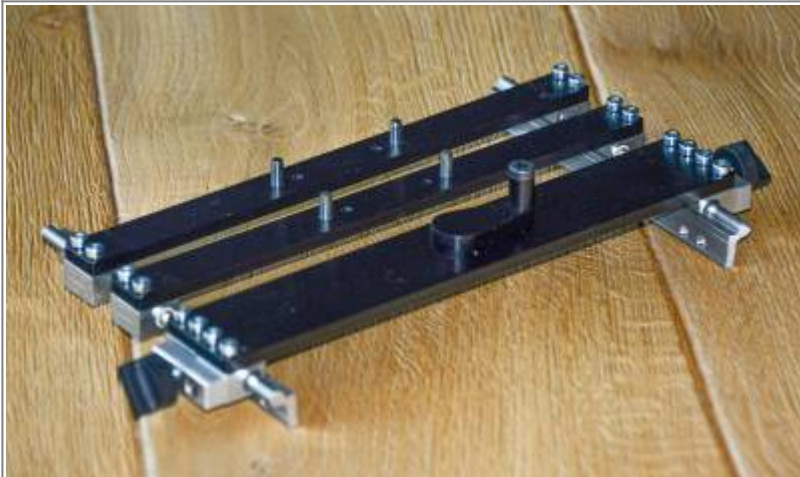

This is what the vise looks like before having installed it on the X200 engraving table.



Remove the 2 hex screws (M5x10), the 2 washers and the left table stop, indicated with green arrows on the image on the left.

the machine's mac address in the "customer number" field. This is a unique code which is linked to the X-200 cnc controller.

On the USB memory stick which was supplied with your machine you will find the release code which you have to type into the "Registration Code" field. Here on the left is an example of an application window with a correct registration code: If your registration code is correct, the virtual software will accept it and release the product.

From:
<https://manualscyborg-engraverscom.webhosting.be/> - cyborg-engravers

Permanent link:
https://manualscyborg-engraverscom.webhosting.be/doku.php?id=en:x200:quick_lock_vise&rev=1759324729

Last update: 2025/10/01 15:18

