


# Cancel temporary home / return to last home

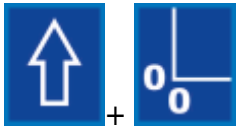

## Cancelling the temporary home.

When using this key combination the X and Y coordinate fields in the virtual pendent will no longer show the 0.00 mm coordinate.

Instead you will see the coordinates count between the machine origin and the spindle position above the engraving table.

Returning to Machine Home. Press the SHIFT  and then the SET HOME  hot keys.

Then push  to make the spindle return to the machine home.

## Return to last home after machine reboot.

When using this key combination the spindle will return to the last used origin, even if this origin was not explicitly saved.

Returning to last job origin. Press the SHIFT  and then the SET HOME  hot keys.

Return to [the keypad overview](#).

Continue to [the table of contents](#).

From:  
<https://manualscyborg-engraverscom.webhosting.be/> - cyborg-engravers

Permanent link:  
[https://manualscyborg-engraverscom.webhosting.be/doku.php?id=en:x200:shift\\_set\\_home\\_key&rev=1745307250](https://manualscyborg-engraverscom.webhosting.be/doku.php?id=en:x200:shift_set_home_key&rev=1745307250)

Last update: 2025/04/22 09:34

