



Component names and functions

Front view

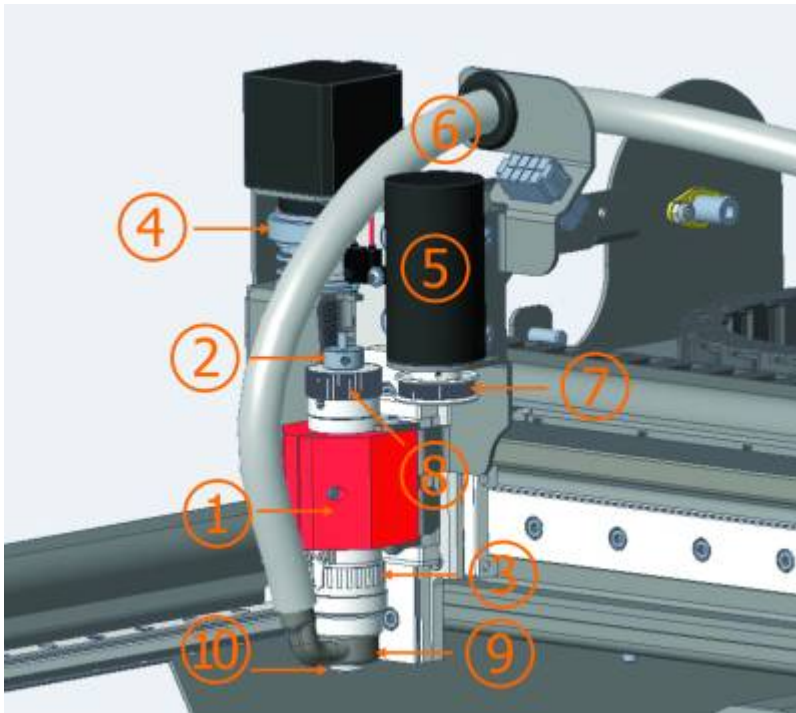

1	spindle
2	cutter knob
3	graduated depth regulating ring
4	spring pressure regulating ring
5	spindle motor
6	dust hose
7	motor pulley
8	spindle pulley
9	vacuum boot
10	depth limiting nosecone


Rear view

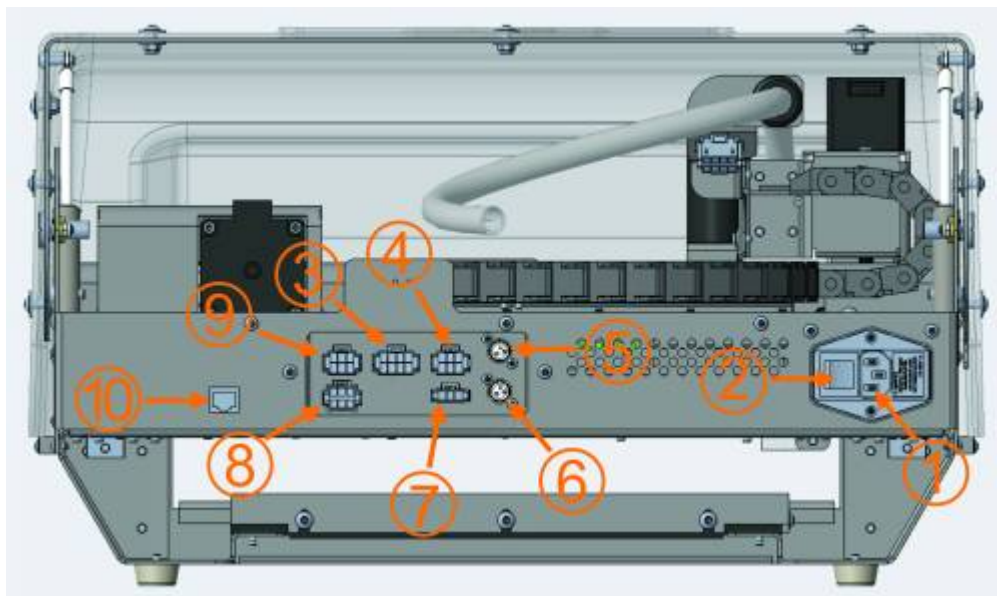

1	power supply socket
2	On/off switch (main switch)
3	socket for engraving motor control
4	socket for rotary device (optional)
5	socket for vacuum control (aux 1)
6	socket for mister control (aux 2)
7	socket for Z-axis proximity switch
8	socket for Y-axis motor
9	socket for Z-axis motor
10	ethernet socket

Virtual pendent

1)

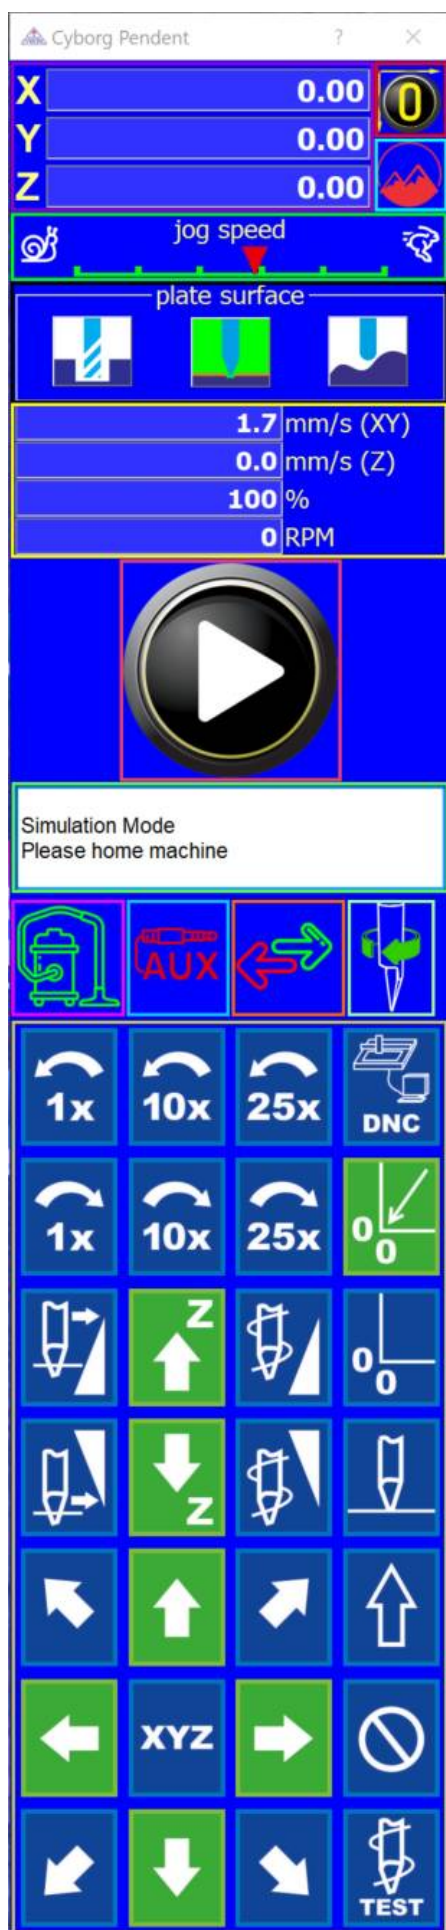

coordinates of the
actual spindle position

actual home position

mapped surface
active or not active

jog speed scale

plate surface mode

job speed information

start - pause - resume

status bar and
comments field

vacuum cleaner on/off

auxiliary on/off

unidirectional or bidirectional
engraving

rotary engraving or
diamond scratching

motion control keys

1)
uitleg bij de afbeelding zit nu mee in de afbeelding verwerkt - moet afzonderlijk, zodat de tekst vertaalbaar is

From:
<https://manualscyborg-engraverscom.webhosting.be/> - **cyborg-engravers**

Permanent link:
<https://manualscyborg-engraverscom.webhosting.be/doku.php?id=en:x300:components&rev=1663418166>

Last update: **2022/09/17 14:36**

