



Benaming van onderdelen en functies

Vooraanzicht

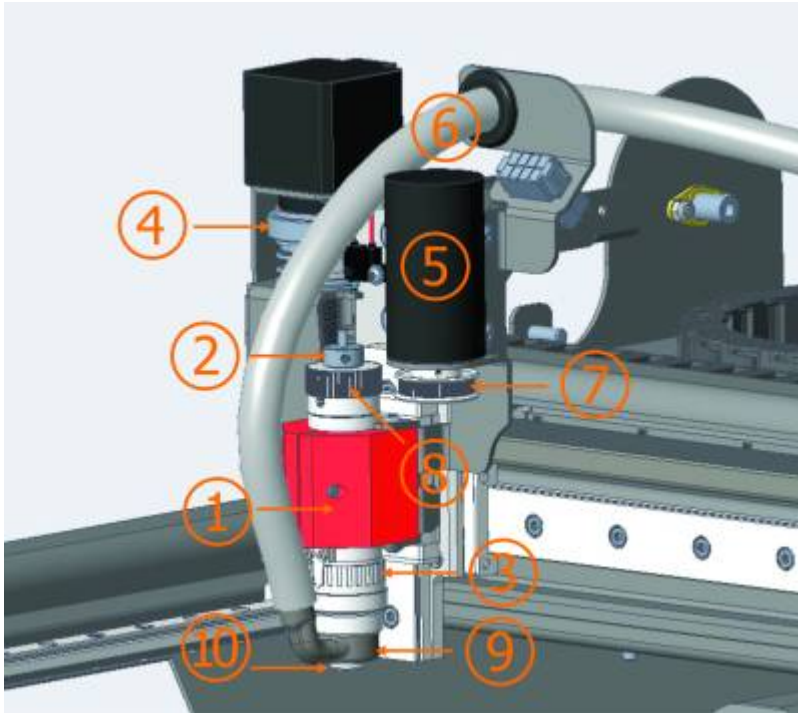


1	spindel
2	spanknop
3	gegradueerde diepte regelring
4	reglering voor veerdruk
5	spindel motor
6	afzuigslang
7	motor riemschijf
8	spindel riemschijf
9	stofafzuigvoet
10	neusconus voor dieptebegrenzing

Rear view

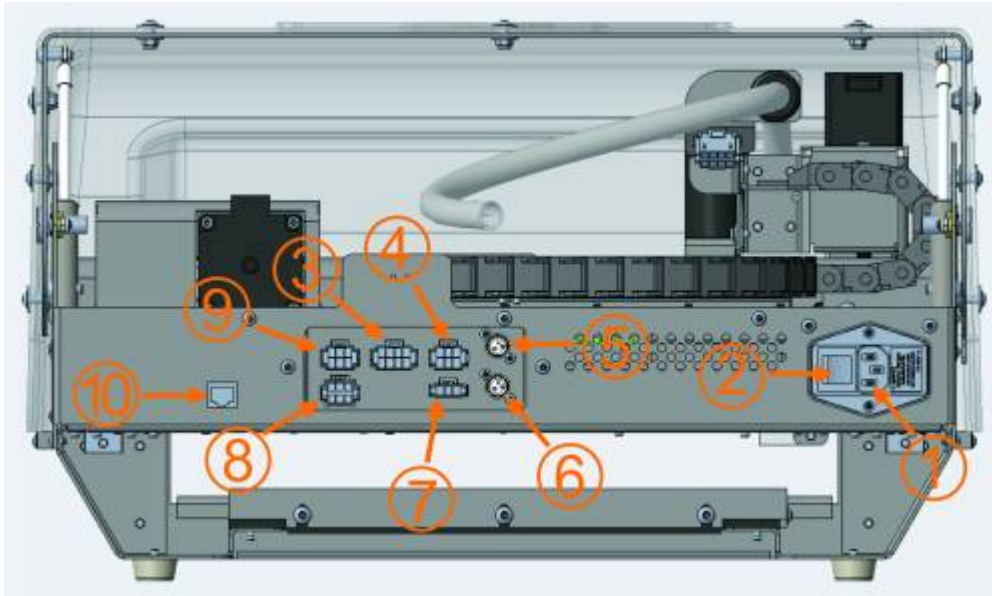

1	power supply socket
2	On/off switch (main switch)
3	socket for engraving motor control
4	socket for rotary device (optional)
5	socket for mister control (aux 2)
6	socket for vacuum control (aux 1)
7	socket for Z-axis proximity switch
8	socket for Y-axis motor
9	socket for Z-axis motor
10	ethernet socket

Virtual pendent

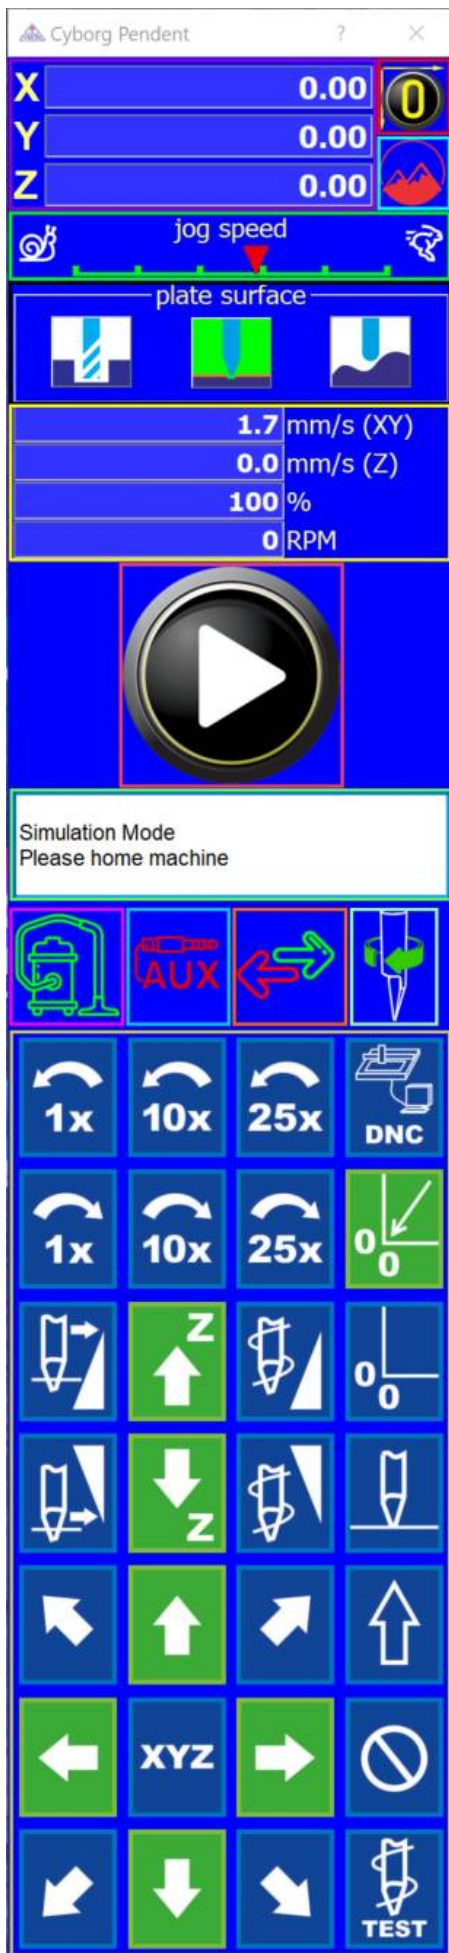

coordinates of the
actual spindle position

actual home position

mapped surface
active or not active

jog speed scale

plate surface mode

job speed information

start - pause - resume

status bar and
comments field

vacuum cleaner on/off

auxiliary on/off

unidirectional or bidirectional
engraving

rotary engraving or
diamond scratching

motion control keys

Last update:

2022/11/29 nl:x300:components <https://manualscyborg-engraverscom.webhosting.be/doku.php?id=nl:x300:components&rev=1669717233>
11:20

Continue to [X-300 installation environment](#).

Continue to [the table of contents](#).

From:

<https://manualscyborg-engraverscom.webhosting.be/> - **cyborg-engravers**

Permanent link:

<https://manualscyborg-engraverscom.webhosting.be/doku.php?id=nl:x300:components&rev=1669717233>

Last update: **2022/11/29 11:20**

