



Benaming van onderdelen en functies

Vooraanzicht

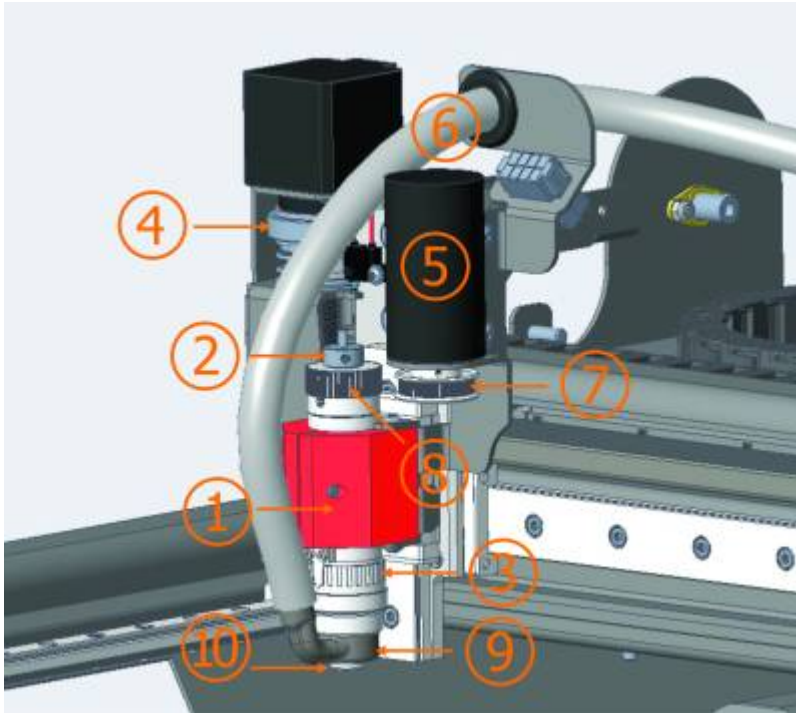


1	spindel
2	spanknop
3	gegradueerde diepte regelring
4	regelring voor veerdruk
5	spindel motor
6	afzuigslang
7	motor riemschijf
8	spindel riemschijf
9	stofafzuigvoet
10	neusconus voor dieptebegrenzing

Rear view

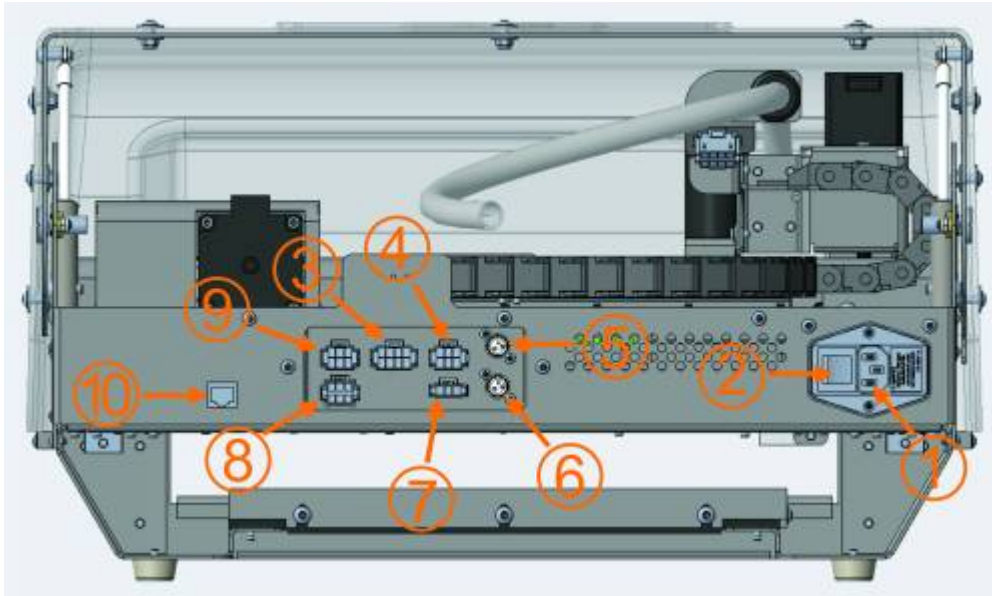

1	power supply socket
2	On/off switch (main switch)
3	socket for engraving motor control
4	socket for rotary device (optional)
5	socket for mister control (aux 2)
6	socket for vacuum control (aux 1)
7	socket for Z-axis proximity switch
8	socket for Y-axis motor
9	socket for Z-axis motor
10	ethernet socket

Virtual pendent

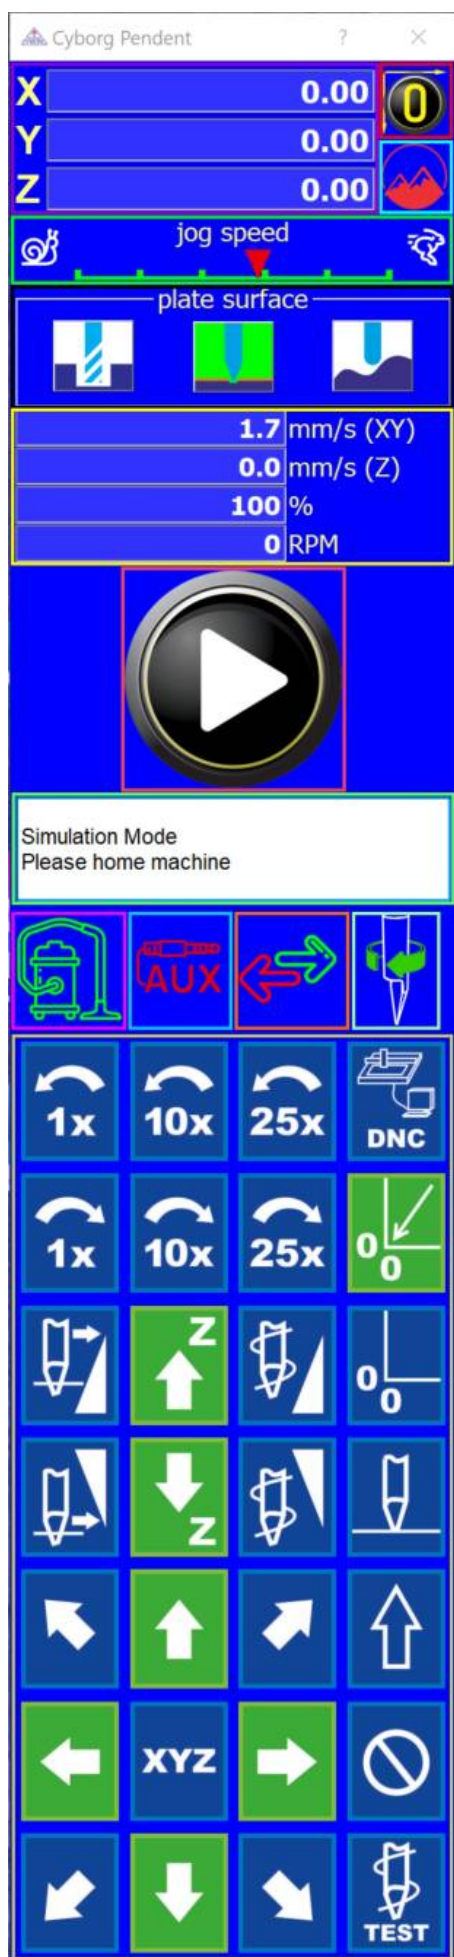

coordinates of the
actual spindle position

actual home position

mapped surface
active or not active

jog speed scale

plate surface mode

start - pause - resume

status bar and
comments field

vacuum cleaner on/off

auxiliary on/off

unidirectional or bidirectional engraving

rotary engraving or
diamond scratching

motion control keys

Continue to [X-300 installation environment](#).
Continue to [the table of contents](#).

From:
<https://manualscyborg-engraverscom.webhosting.be/> - **cyborg-engravers**

Permanent link:
<https://manualscyborg-engraverscom.webhosting.be/doku.php?id=nl:x300:components&rev=1669717267>

Last update: **2022/11/29 11:21**

