



Benaming van onderdelen en functies

Vooraanzicht

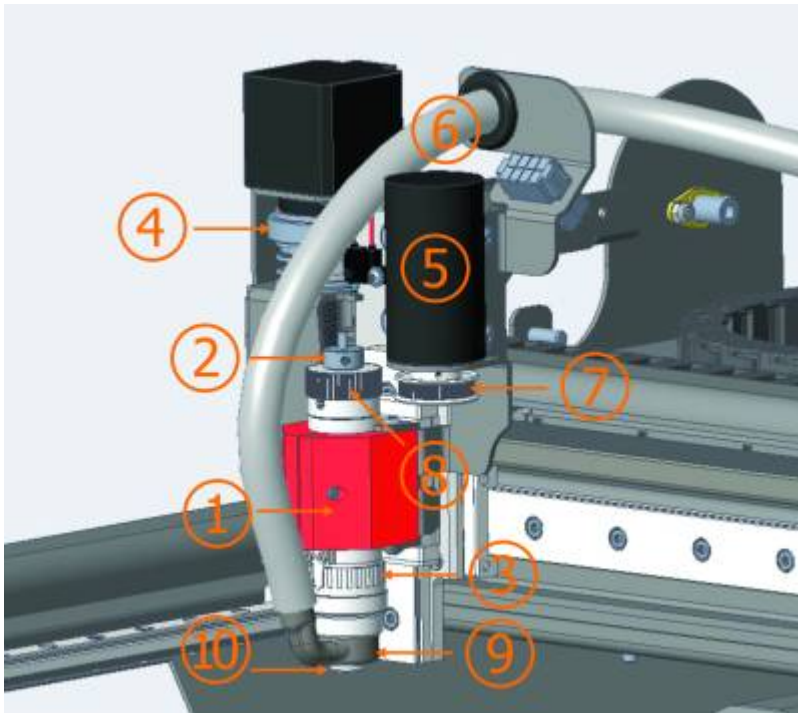


1	spindel
2	spanknop
3	gegradueerde diepte regelring
4	regelring voor veerdruk
5	spindel motor
6	afzuigslang
7	motor riemschijf
8	spindel riemschijf
9	stofafzuigvoet
10	neusconus voor dieptebegrenzing

Achteraanzicht

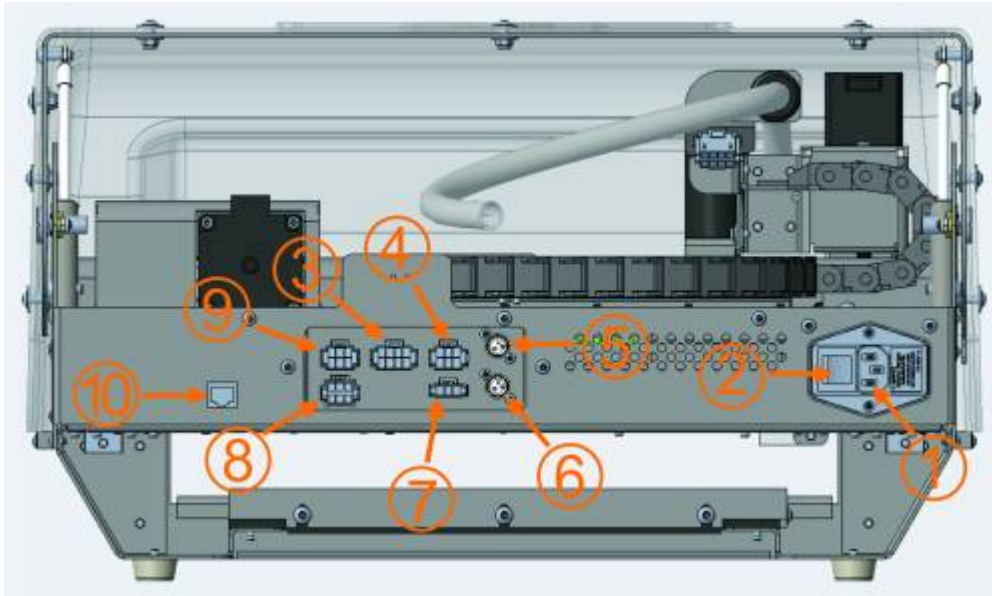

1	stopcontact voor voedingskabel
2	Aan/Uit schakelaar (hoofdschakelaar)
3	connector voor graveermotor
4	connector voor roterend accessoire (optioneel)
5	connector voor mister systeem (aux 2)
6	connector voor stofzuiger controle (aux 1)
7	connector voor Z-as benaderingsschakelaar
8	connector voor Y-as motor
9	connector voor Z-as motor
10	ethernet aansluiting

Virtuele pendent

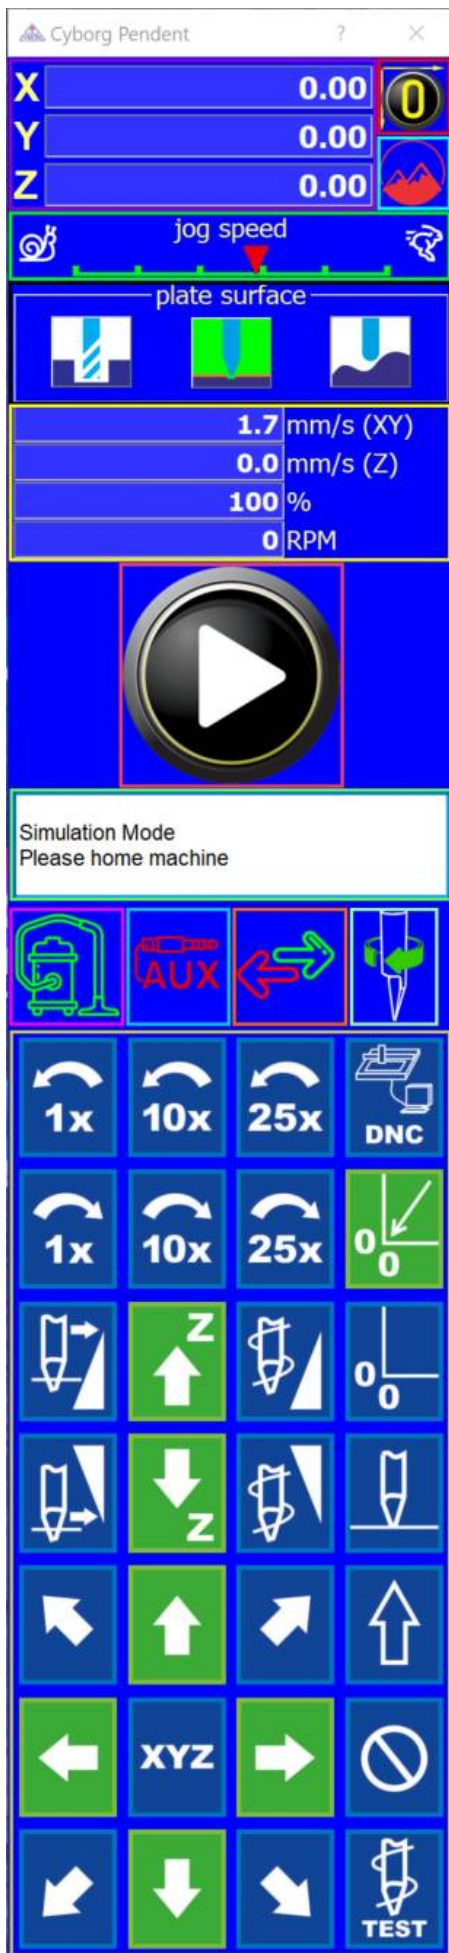

coordinates of the
actual spindle position

actual home position

mapped surface
active or not active

jog speed scale

plate surface mode

job speed information

start - pause - resume

status bar and
comments field

vacuum cleaner on/off

auxiliary on/off

unidirectional or bidirectional
engraving

rotary engraving or
diamond scratching

motion control keys

Last update:

2022/11/29 nl:x300:components <https://manualscyborg-engraverscom.webhosting.be/doku.php?id=nl:x300:components&rev=1669717685>
11:28

Ga verder naar [de installatie omgeving](#).

Ga verder naar [de inhoudstafel](#).

From:

<https://manualscyborg-engraverscom.webhosting.be/> - **cyborg-engravers**

Permanent link:

<https://manualscyborg-engraverscom.webhosting.be/doku.php?id=nl:x300:components&rev=1669717685>

Last update: **2022/11/29 11:28**

